



Carichi radiali e assiali / Radial and axial load / Radial und Axial Belastungen [N]														
Grandezza Size Größe	XA - XC - XF												XA	
	uscita / output / Abtrieb												entrata / input / Antrieb $n_1=1400 \text{ min}^{-1}$	
	i												F_{r1}	F_{a1}
7.5	10	15	20	25	30	40	50	65	80	100				
30	F_{r2}	750	775	800	850	900	950	1000	1100	1200	1300	1450	100	20
	F_{a2}	150	115	160	170	180	190	200	220	240	260	290		
40	F_{r2}	1150	1200	1250	1350	1500	1600	1700	1800	1950	2100	2300	220	44
	F_{a2}	230	240	250	270	300	320	340	360	390	420	460		
50	F_{r2}	1200	1400	1600	1900	2100	2500	2800	3000	3200	3200	3200	400	80
	F_{a2}	240	280	320	380	420	500	560	600	640	640	640		
63	F_{r2}	1250	1700	1750	2000	2500	2700	3000	3250	3500	3700	3900	480	96
	F_{a2}	250	340	350	400	500	540	600	650	700	740	780		
75	F_{r2}	1300	1900	2300	2500	3000	3200	3500	3800	4100	4400	4700	750	150
	F_{a2}	260	380	460	500	600	640	700	760	820	880	940		
90	F_{r2}	1350	2100	2500	2700	3500	3700	3900	4300	5000	5500	5800	850	170
	F_{a2}	270	240	500	540	700	740	780	860	1000	1100	1160		
110	F_{r2}	1400	2700	3600	4500	5000	5400	6300	6900	7500	8000	8000	1200	240
	F_{a2}	280	540	720	900	1000	1080	1260	1380	1500	1600	1600		



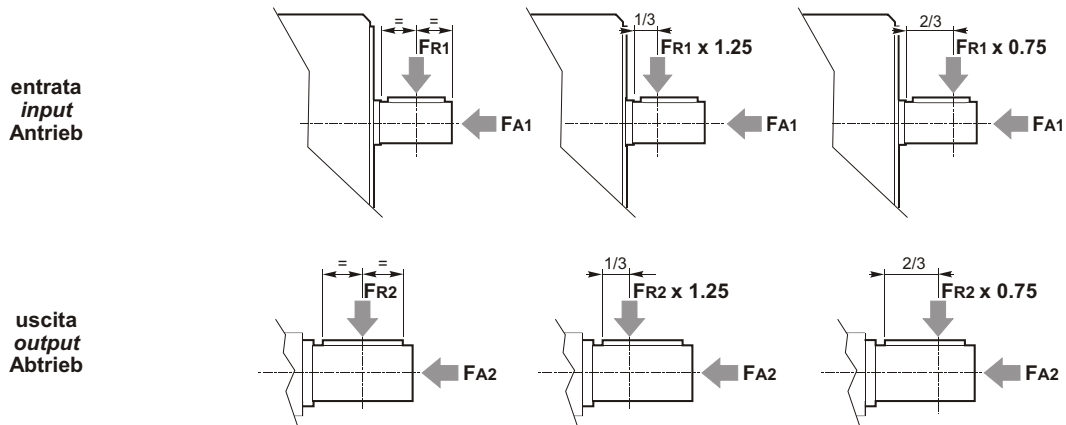

Carichi radiali e assiali / Radial and axial load / Radial und Axial Belastungen [N]														
Grandezza Size Größe	HA - HF											HA		
	uscita / output / Abtrieb											entrata / input / Antrieb $n_1=1400 \text{ min}^{-1}$		
	i											F_{r1}	F_{a1}	
30	40	60	80	100	120	160	200	260	320	400				
40	F_{r2}	1500	1700	1800	1900	2000	2500	2500	2500	2500	2500	2500	150	30
	F_{a2}	300	340	360	380	400	500	500	500	500	500	500		
50	F_{r2}	2000	2300	2700	2900	2900	3000	3500	3500	3500	3500	3500	230	46
	F_{a2}	400	460	540	580	580	600	700	700	700	700	700		
63	F_{r2}	2500	2700	3500	4500	5000	5000	5000	5000	5000	5000	5000	320	64
	F_{a2}	500	540	700	900	1000	1000	1000	1000	1000	1000	1000		
75	F_{r2}	3200	3400	4350	5000	5750	5750	5750	5750	5750	5750	5750	570	114
	F_{a2}	340	680	870	1000	1150	1150	1150	1150	1150	1150	1150		
90	F_{r2}	5000	5100	5550	5900	6950	7000	7000	7000	7000	7000	7000	570	114
	F_{a2}	1000	1020	1110	1180	1390	1400	1400	1400	1400	1400	1400		
110	F_{r2}	6000	6100	7000	7200	7700	8000	8000	8000	8000	8000	8000	800	160
	F_{a2}	1200	1220	1400	1440	1540	1600	1600	1600	1600	1600	1600		

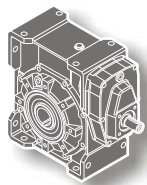